


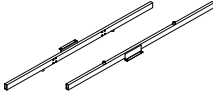
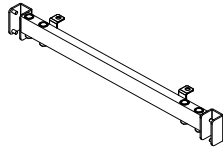
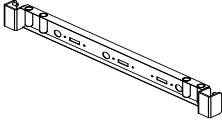
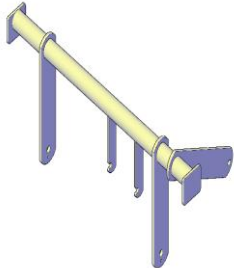
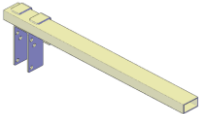



DAFTAR KOMPONEN BED

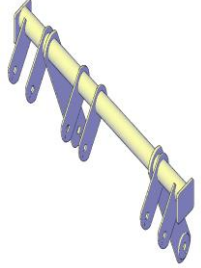

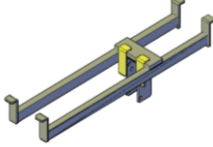

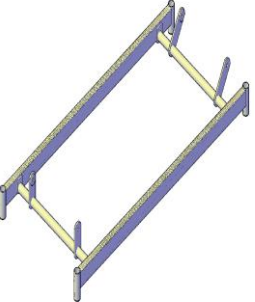

KODE PRODUK : CB-3300 D PLUS
 TIPE PRODUK : BED ELECTRIC
 NAMA MODEL : 4 BOTTOM HI-LO GATCH BED
 SISTEM OPERASIONAL : 3 MOTOR (Hi-Lo, Back Raise, Foot Raise)
 OPTION BOTTOM : BOTTOM LOKAL & BS-201-1
 OPTION HF BOARD : BS-006A, BD-003, OPTIMUS
 OPTION CASTER : BS-028 5 INCH WITH LOCK, WITHOUT LOCK
 OPTION SIDE RAIL : BS-015A SIDE RAIL, BS-019 SIDE RAIL, BS-025 ALUMUNIUM SIDE RAIL

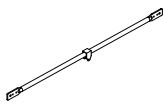




| No | Photo Componen Compl | Nama Komponen | Spesifikasi Komponen (mm) | Qty / Unit | Suplier + Sub Con | Keterangan | Fungsi | |
|----|--|-------------------------------|---|------------|-------------------|--------------------------|--------|--|
| 1 | | Main Frame Compl | | 1 | | | | |
| | | Side Frame (LH/RH) | | 2 | | | | |
| |  | Side Frame (LH/RH) | Pipa Kotak 60/30 x 1.8 x 1998 STKM 11A | 2 | pcs | ISTW/Sri Rejeki + CIM | Lokal | Komponen utama main frame assy |
| | | Stopper Bracket [K-202048] | Pl.t 3.2 x 30 x 63 SPHC | 2 | pcs | USC/SSI + Hinani | Lokal | |
| | | Braket Center [K-202049] | Pl.t 3.2 x 102 x 220 SPHC | 2 | pcs | USC/SSI + Rajawali | Lokal | |
| | | Stopper | Pipa Bulat Ø25.4 x 1.2 x 22 STKM 11 A | 4 | pcs | ISTW/Sri Rejeki + CIM | Lokal | |
| | | Cross Frame A (HEAD) | | 1 | | | | |
| |  | Cross Frame A Head | Pipa Kotak 60/30 x 1.8 x 750 STKM 11A | 1 | pcs | ISTW/Sri Rejeki + CIM | Lokal | Komponen pengikat main frame assy (Head), juga sebagai tempat HF Board terpasang |
| | | Bracket (R/L) K-212015 | | 2 | | | | |
| | | Hook Bracket [K-212015] | Pl.t 4.5 x 95 x 135 SPHC | 2 | pcs | USC/SSI + Hinani | Lokal | |
| | | Pin [K-005016] | Ø10 x Ø8 x 19.5 SS400 | 4 | pcs | Rajawali | Lokal | |
| | | Stopper Bracket [K-202048] | Pl.t 3.2 x 30 x 63 SPHC | 2 | pcs | USC/SSI + Hinani | Lokal | |
| | | Holder C [K-300002C] | Pipa Bulat Ø22.2 x 1.0 x 85(78) STKM 11 A | 4 | pcs | ISTW/Sri Rejeki + Hinani | Lokal | |


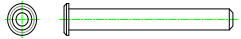
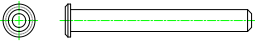







| No | Photo Componen Compl | Nama Komponen | Spesifikasi Komponen (mm) | Qty / Unit | | Suplier + Sub Con | Keterangan | Fungsi |
|----|---|---|---|------------|-----|--------------------------|------------|--|
| | | Cross Frame B (Foot) | | 1 | | | | |
| |  | CROSS FRAME FOOT SIDE MULTY BED | Pl.t 1.6 x 139 x 750 SPCC | 1 | pcs | USC/SSI + Rajawali | Lokal | Komponen pengikat main frame assy (foot), juga sebagai tempat HF Board terpasang |
| | | Bracket (R/L) K-212015 | | 2 | | | | |
| | | Hook Bracket [K-212015] | Pl.t 4.5 x 95 x 135 SPHC | 2 | pcs | USC/SSI + Hinani | Lokal | |
| | | Pin [K-005016] | Ø10 x Ø8 x 19.5 SS400 | 4 | pcs | Rajawali | Lokal | |
| | | Holder C [K-300002C] | Pipa Bulat Ø22.2 x 1.0 x 85(78) STKM 11 A | 4 | pcs | ISTW/Sri Rejeki + Hinani | Lokal | |
| | | Cross Member A Head Compl | | 1 | | | | |
| |  | Cross pipe | Pipa Bulat Ø34 x 2.6 x 611 STKM 11 A | 1 | pcs | ISTW/Sri Rejeki | Lokal | Komponen penghubung mekanisme lipat pada torque tube head raise |
| | | Plate [F-030110-2] | Pl.t 4.5 x 50 x 60 SPHC | 2 | pcs | USC/SSI + Rajawali | Lokal | |
| | | Bracket Hook [K-103004] | Pl.t 4.5 x 25 x 110.5 (SPHC) | 2 | pcs | USC/SSI + Rajawali | Lokal | |
| | | Arm Optimus [Bracket K-110016 tanpa Ring plate] | Pl.t 6.0 x 50 x 242 SPHC | 1 | pcs | USC/SSI + Rajawali | Lokal | |
| | | Bracket Compl K-110016 | Assy Rajawali (Las) | 2 | | | | |
| | | Bracket [K-110016] | Pl.t 6.0 x 50 x 242 SPHC | 2 | pcs | USC/SSI + Rajawali | Lokal | |
| | | Plate [K-200003] | Pl.t 4.5 x Ø40 (OD) x Ø12.2 (ID) SPHC | 2 | pcs | USC/SSI + Rajawali | Lokal | |
| | | Cross Frame Center | | 1 | | | | |
| |  | Cross Frame Center | Pipa Kotak 50/30 x 1.6 x 620 STKM 11A | 1 | pcs | ISTW/Sri Rejeki | Lokal | Komponen support untuk pengikat Crank atau Actuator operating system |
| | | Bracket [K-202023] | Pl.t 3.2 x 50 x (152) SPHC | 1 | pcs | USC/SSI + Hinani | Lokal | |
| | | Angle [K-202061] | Pl.t 4.5 x 35 x 98 SPHC | 2 | pcs | USC/SSI + Hinani | Lokal | |
| | | Cross Member B Foot Compl | | 1 | | | | |
| |  | Cross pipe | Pipa Bulat Ø34 x 2.6 x 611 STKM 11 A | 1 | pcs | ISTW/Sri Rejeki | Lokal | Komponen penghubung mekanisme lipat pada torque tube foot raise |
| | | Plate [F-030110-2] | Pl.t 4.5 x 50 x 60 SPHC | 2 | pcs | USC/SSI + Rajawali | Lokal | |
| | | Crank Bracket [K-100032] | Pl.t 3.2 x 50 x 120 SPHC | 4 | pcs | USC/SSI + Rajawali | Lokal | |
| | | CRANK BRACKET MULTY BED | Pl.t 3.2 x 50 x 95 SPHC | 2 | pcs | USC/SSI + Rajawali | Lokal | |
| | | Bracket Compl K-110017 | Assy Rajawali (Las) | 2 | | | | |
| | | Bracket [K-110017] | Pl.t 6.0 x 50 x 262 SPHC | 2 | pcs | USC/SSI + Rajawali | Lokal | |
| | | Plate [K-200003] | Pl.t 4.5 x Ø40 (OD) x Ø12.2 (ID) SPHC | 2 | pcs | USC/SSI + Rajawali | Lokal | |


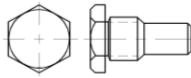
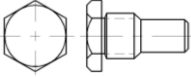


| No | Photo Componen Compl | Nama Komponen | Spesifikasi Komponen (mm) | Qty / Unit | | Suplier + Sub Con | Keterangan | Fungsi |
|----------|--|------------------------------|--|------------|-----|-----------------------|------------|--|
| | | Bracket Frame Compl | | 1 | | | | |
| |  | Frame A | Pipa Kotak 30/20 x 1.6 x 652 STKM 11A | 2 | pcs | ISTW/Sri Rejeki | Lokal | Komponen support untuk pengikat Motor actuator operating system |
| | | Plate | Plate strip T.10 x 50 x 140 | 1 | pcs | Sinar Logam | Lokal | |
| | | Bracket [KC-202023] Timotion | Pl.t 4.5 x 50 x (310) SPHC | 1 | pcs | USC/SSI + Hinani | Lokal | |
| | | Plate support | Plate Strip T.5 x 30 x 98 | 2 | pcs | Sinar Logam | Lokal | |
| | | Angle [K-202061] | Pl.t 4.5 x 35 x 98 SPHC | 4 | pcs | USC/SSI + Hinani | Lokal | |
| | | Harness Bar | Astall dia 6 x 1180 | 1 | pcs | Rajawali | Lokal | |
| | | Roller Support [K-212005 L] | Pl.t 1.6 x 70.6 x 340 SPCC | 1 | pcs | USC/SSI + Rajawali | Lokal | |
| | | Roller Support [K-212005 R] | Pl.t 1.6 x 70.6 x 340 SPCC | 1 | pcs | USC/SSI + Rajawali | Lokal | |
| 2 | | Lower Frame Compl | | 1 | | | | |
| |  | Side frame lower L/R | Pipa kotak 60/30 x 1.8 x 1443 STKR | 2 | pcs | ISTW/Sri Rejeki + CIM | Lokal | Komponen utama yang berfungsi sebagai base support main frame dan tempat terpasangnya Caster |
| | | Cross Frame Compl L | | 1 | | | | |
| | | Cross Frame | Pipa Bulat Ø34 x 2.6 x 611 STKM 11 A | 1 | pcs | ISTW/Sri Rejeki | Lokal | |
| | | End Plate [H-002200-3] | Pl.t 4.5 x 44 x 57 SPHC | 2 | pcs | USC/SSI + Rajawali | Lokal | |
| | | Arm Compl | Assy Rajawali (Las) | 2 | | | | |
| | | Arm [K-110018] | Pl.t 6.0 x 50 x 138 SPHC | 2 | pcs | USC/SSI + Rajawali | Lokal | |
| | | Plate [K-200003] | Pl.t 4.5 x Ø40 (OD) x Ø12.2 (ID) SPHC | 2 | pcs | USC/SSI + Rajawali | Lokal | |
| | | Cross Frame Compl R | | 1 | | | | |
| | | Cross Frame | Pipa Bulat Ø34 x 2.6 x 611 STKM 11 A | 1 | pcs | ISTW/Sri Rejeki | Lokal | |
| | | End Plate [H-002200-3] | Pl.t 4.5 x 44 x 57 SPHC | 2 | pcs | USC/SSI + Rajawali | Lokal | |
| | | Arm Compl | Assy Rajawali (Las) | 2 | | | | |
| | | Arm [K-110019] | Pl.t 6.0 x 50 x 175 SPHC | 2 | pcs | USC/SSI + Rajawali | Lokal | |
| | | Plate [K-200003] | Pl.t 4.5 x Ø40 (OD) x Ø12.2 (ID) SPHC | 2 | pcs | USC/SSI + Rajawali | Lokal | |
| | | Foot Pipe Compl | | 4 | | | | |
| | | Foot Pipe | Pipa Bulat Ø38.1 x 1.6 x 105 STKM 11 A | 4 | pcs | ISTW/Sri Rejeki | Lokal | |
| | | Nut For Caster [K-003004] | Ø38.1 x 21 SS400 | 4 | pcs | Rajawali | Lokal | |


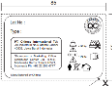




| No | Photo Componen Compl | Nama Komponen | Spesifikasi Komponen (mm) | Qty / Unit | | Suplier + Sub Con | Keterangan | Fungsi |
|----|---|---|---|------------|-----|-----------------------|------------|---|
| 3 | | Bottom Assy (Lihat DSKB optional) | | 2 | | | | |
| |  | BS-201-1 SLEEPING PANEL | SLEEPING PANEL 1957*920mm | 1 | SET | BOSSAY | Import | Komponen utama sebagai papan penyangga pasien (tempat tidur pasien) |
| 4 | | Hi-Lo Torque Tube (H) Compl H-002020 | | | | | | |
| |  | Torque Tube [H-002021] | Pipa Bulat Ø34 x 2.6 x 388 STKM 11 A | 1 | pcs | ISTW/Sri Rejeki + CIM | Lokal | Komponen support untuk mekanisme naik dan turun ranjang pasien posisi head area |
| | | Reinforcement [H-002020-2] | Pl.t 3.2 x 94 x 103 SPHC | 1 | pcs | USC/SSI + Hinani | Lokal | |
| | | Bearing [K-006009] | Ø28.4 x (L)10 | 2 | pcs | Rajawali | Lokal | |
| | | Arm [K-100002] Timotion | Pl.t 4.5 x 50 x 184 SPHC (jarak lubang 14 mm) | 4 | pcs | USC/SSI + Rajawali | Lokal | |
| | | Arm [K-100033] | Pl.t 6.0 x 50 x 291 SPHC | 2 | pcs | USC/SSI + Rajawali | Lokal | |
| 8 | | Hi-Lo Torque Tube (F) Compl H-002030 | | 1 | | | | |
| |  | Torque Tube [H-002021] | Pipa Bulat Ø34 x 2.6 x 388 STKM 11 A | 1 | pcs | ISTW/Sri Rejeki + CIM | Lokal | Komponen support untuk mekanisme naik dan turun ranjang pasien posisi foot area |
| | | Bearing [K-006009] | Ø28.4 x (L)10 | 2 | pcs | Rajawali | Lokal | |
| | | Arm [K-100002] Timotion | Pl.t 4.5 x 50 x 184 SPHC (jarak lubang 14 mm) | 2 | pcs | USC/SSI + Rajawali | Lokal | |
| | | Arm [K-100033] | Pl.t 6.0 x 50 x 291 SPHC | 2 | pcs | USC/SSI + Rajawali | Lokal | |
| 9 | | Hi-Lo Rod Compl H-002040 | | 1 | | | | |
| |  | Rod [H-002040-1] | Pipa Bulat Ø31.8 x 1.6 x 1340 STKM 11 A | 1 | pcs | ISTW/Sri Rejeki + CIM | Lokal | Komponen penghubung Crank atau Motor actuator |
| | | Spacer [H-002040]] | Pl.t 3.2 x 25 x 110 SPHC | 2 | pcs | USC/SSI + Rajawali | Lokal | |
| | | Bracket [F-030402] | Pl.t 3.2 x 40 x 168 SPHC | 1 | pcs | USC/SSI + Hinani | Lokal | |

| No | Photo Componen Compl | Nama Komponen | Spesifikasi Komponen (mm) | Qty / Unit | | Suplier + Sub Con | Keterangan | Fungsi |
|-----------|---|---|---------------------------|------------|-----|-------------------|------------|--|
| 10 | | Operating System 3 Motor | | | | | | |
| |  | Actuator Stroke 200 (TA23-2L-200373-21122-01016-4T0) | S = 200 for backrest | 1 | pcs | Timotion | Lokal | Komponen utama mekanisme Operating system ranjang pasien |
| |  | Actuator Stroke 200 Safety nut (TA23-2L-200373-21122-11015-4T0) | S = 200 for Hi-Lo | 1 | pcs | Timotion | Lokal | |
| |  | Actuator Stroke 100 (TA23-2L-100288-21122-01015-4T0) | S = 100 for Foot rest | 1 | pcs | Timotion | Lokal | |
| |  | Control Box (TC26-5T0311-312140-0211) | - | 1 | pcs | Timotion | Lokal | |
| |  | Hand set (TH10-B322-30451-001) | - | 1 | pcs | Timotion | Lokal | |
| |  | Pin C [K-005004-C] | Ø14 x Ø10 x (L)54 S20C | 5 | pcs | Sagatek | Lokal | |
| |  | Snap Pin Dia 10 | Ø10 | 6 | pcs | CKA | Lokal | Komponen support assy |
| |  | Snap Pin Dia 12 | Ø12 | 1 | pcs | CKA | Lokal | Komponen support assy |

| No | Photo Componen Compl | Nama Komponen | Spesifikasi Komponen (mm) | Qty / Unit | | Suplier + Sub Con | Keterangan | Fungsi |
|----|---|---|---------------------------|------------|-----|-------------------|------------|---|
| 11 | | Head & Foot Board Assy (<i>Lihat DSKB optional</i>) | | | | | | |
| |  | BD-003 | >PP< | 1 | SET | Kyoraku | Lokal | Komponen papan pelindung pasien area kepala dan kaki (Head atau Foot Board) |
| |  | BS-006A HEAD FOOTBOARD | >PP< | 1 | SET | BOSSAY | Import | Komponen papan pelindung pasien area kepala dan kaki (Head atau Foot Board) |
| 12 | | Side rail Assy (<i>Lihat DSKB optional</i>) | | 2 | | | | |
| |  | BS-015A SIDE RAIL | >PP< | 1 | SET | BOSSAY | Import | Komponen pelindung pasien kanan dan kiri (type kupu kupu) |
| |  | BS-019 SIDE RAIL | >PP< | 1 | SET | BOSSAY | Import | Komponen pelindung pasien kanan dan kiri (type kupu kupu) |
| |  | BS-025 ALUMUNIU SIDE RAIL | >AL< | 1 | SET | BOSSAY | Import | Komponen pelindung pasien kanan dan kiri (type FSR) |

| No | Photo Componen Compl | Nama Komponen | Spesifikasi Komponen (mm) | Qty / Unit | | Suplier + Sub Con | Keterangan | Fungsi |
|----|---|---------------------------|---|------------|-----|-------------------|------------|-----------------------|
| 13 | | Assy Part | | | | | | |
| |  | Bottom Stopper multy bed | Ø8 x 950 SS400 | 1 | pcs | Rajawali | Lokal | Komponen support assy |
| |  | Pin B [K-005019-B] | Ø12 x Ø8 x 16 S20C | 2 | pcs | Cakra B | Lokal | Komponen support assy |
| |  | Pin H [K-005019-H] | Ø12 x Ø8 x 41 S20C | 4 | pcs | Cakra B | Lokal | Komponen support assy |
| |  | Roller [K-500001] | Colour = White [PE] | 2 | pcs | Santo Plastic | Lokal | Komponen support assy |
| |  | Cushion Rubber [K-501009] | Ø20 x Ø16.5 x (H)10 Colour = Black | 4 | pcs | P.Rubber | Lokal | Komponen support assy |
| |  | Cap 20 X 30 [K-503003] | (H)13 x (W)20 x (L)30 Colour = Ivory [PE] | 12 | pcs | Santo Plastic | Lokal | Komponen support assy |
| |  | Cap Dia 38 [K-503004] | Ø38.1 x (H)20 Colour = Grey [PE] | 4 | pcs | Santo Plastic | Lokal | Komponen support assy |
| |  | S/W (Spring Washer) | Ø16 | 4 | pcs | Cahaya.N | Lokal | Komponen support assy |
| |  | Pin A [K-005020-A] | Ø18 x Ø12 x (L)52 S20C | 2 | pcs | Cakra B | Lokal | Komponen support assy |
| |  | P/W (Plain Washer) | Ø12 | 4 | pcs | Cahaya.N | Lokal | Komponen support assy |

| No | Photo Componen Compl | Nama Komponen | Spesifikasi Komponen (mm) | Qty / Unit | | Suplier + Sub Con | Keterangan | Fungsi |
|----|---|--|---|------------|-----|-------------------|------------|-----------------------|
| |  | Plastik Cap for Crank | for pipe Ø 31,8 High Density Poly Ethylene (Grey) | 3 | pcs | Santo P/Imai | Lokal | Komponen support assy |
| |  | Dantuki Bolt [K-000001] | M14 x P1.5 x Ø18 x Ø10 x (Lt)31 S20C | 4 | pcs | Cakra B | Lokal | Komponen support assy |
| |  | Dantuki Bolt [K-000002E] | M8 x P1.25 x Ø16.5 x Ø12 x (L)17.5 x (Lt)30 SS400 | 4 | pcs | Cakra B | Lokal | Komponen support assy |
| |  | Pin B [K-005020-B] | Ø18 x Ø12 x (L)24 S20C | 2 | pcs | Cakra B | Lokal | Komponen support assy |
| |  | SPRING PART K-400004 VERSENG | Ø23 x Ø4 x (n)98 x (L)396 SWA | 2 | pcs | Mulia Abadi | Lokal | Komponen support assy |
| |  | Plastic Cap 25.4 (CM-350) | PA/PMMA (Grey) | 3 | pcs | Imai | Lokal | Komponen support assy |
| |  | P/W (Plain Washer) | Ø8 | 4 | pcs | Sagatek | Lokal | Komponen support assy |
| |  | S/W (Spring Washer) | Ø5 | 4 | pcs | Sagatek | Lokal | Komponen support assy |
| |  | BS-028 CASTOR M16X25MM LOCK (5 INCH) | CASTOR M16X25MM LOCK (5 INCH) | 2 | pcs | BOSSAY | Import | Komponen support assy |
| |  | BS-028 CASTOR M16X25MM WITHOUT LOCK (5 INCH) | CASTOR M16X25MM WITHOUT LOCK (5 INCH) | 2 | pcs | BOSSAY | Import | Komponen support assy |
| |  | BS-028 CASTOR CENTRAL LOCK (5 INCH) | CATOR 5 INCH CENTAL LOCK | 4 | pcs | BOSSAY | Import | Komponen support assy |

| No | Photo Componen Compl | Nama Komponen | Spesifikasi Komponen (mm) | Qty / Unit | | Suplier + Sub Con | Keterangan | Fungsi |
|----|---|--|---------------------------|------------|-----|-------------------|------------|---------------------------|
| |  | CHITOSE LABEL (NB) | - | 1 | pcs | TPO | Lokal | Komponen support labeling |
| |  | Lot manufacture label for electric | HVS Sticker 55 x 85 mm | 1 | pcs | TPO | Lokal | Komponen support labeling |
| |  | LABEL SNI BESAR | HVS Sticker UK 25 X 22 MM | 1 | pcs | TPO | Lokal | Komponen support labeling |
| |  | Safety caution label | - | 1 | pcs | TPO | Lokal | Komponen support labeling |
| |  | HAND & CAPACITY CAUTION LABEL K-901038 | - | 1 | pcs | TPO | Lokal | Komponen support labeling |
| |  | STIKER LABEL KEMENKES RI AKD | - | 1 | pcs | Cronos | Lokal | Komponen support labeling |

Cimahi, 16 Januari 2024

| Dibuat Oleh | Diperiksa Oleh | Disetujui Oleh |
|-----------------|----------------|----------------|
| | | |
| Rini | Katmo | Ivo A |
| Product Analist | Team Leader | Group Leader |



Bossay Medical Appliance Co.,Ltd.

ADD:No.11,3rd East Road, Jiangyi Main Street, Leliu Town, Shunde District, Foshan City, Guangdong Province, China
 TEL:86 757 27839511 Mob:86 15626095286 FAX:86 757 27839512

PROFORMA INVOICE

Customer

Name: Febby
 Company PT CHITOSE INTERNASIONAL TBK
 Address: JL INDUSTRI III NO5 CIMAHI
 Contact: febbyzao@gmail.com overseas@chitose-indonesia.com
 Tel: +6222 6031900

Invoice No.: BS20230530
 Date: May30th,2023
 Terms: EXW
 Payment: T/T

| PICTURE | NAME OF ITEM | QTY | UNIT PRICE | AMOUNT | No. |
|---------|---|-----|------------|-----------|-----|
| | BS-201 SLEEPING PANEL | 3 | \$ 20.00 | \$ 60.00 | |
| | BS-201-1 SLEEPING PANEL | 3 | \$ 21.00 | \$ 63.00 | 3 |
| | BS-44-1 CRANK SET FOR BACKREST | 3 | \$ 9.50 | \$ 28.50 | |
| | BS-44-2 CRANK SET FOR FOOTREST | 3 | \$ 9.50 | \$ 28.50 | |
| | BS-44-2 CRANK SET FOR HEIGHT ADJUSTMENT | 3 | \$ 9.50 | \$ 28.50 | |
| | BS-015 A SIDE RAIL | 4 | \$ 82.00 | \$ 328.00 | 12 |
| | BS-025 ALUMINIUM SIDE RAIL | 4 | \$ 25.00 | \$ 100.00 | 12 |



Bossay Medical Appliance Co.,Ltd.

ADD:No.11,3rd East Road, Jiangyi Main Street, Leliu Town, Shunde District, Foshan City, Guangdong Province, China

TEL:86 757 27839511

Mob:86 15626095286

FAX:86 757 27839512

PROFORMA INVOICE

Customer

Name: Febby
Company PT CHITOSE INTERNASIONAL TBK
Address: JL INDUSTRI III NO5 CIMAHI
Contact: febbyzao@gmail.com overseas@chitose-indonesia.com
Tel: +6222 6031900

Invoice No.: BS20230530
Date: May30th,2023
Terms: EXW
Payment: T/T

| PICTURE | NAME OF ITEM | QTY | UNIT PRICE | AMOUNT | No. |
|---|---|-----|------------|-----------|-----|
|  | BS-004 A HEAD FOOTBOARD | 4 | \$ 43.50 | \$ 174.00 | |
|  | BS-005 A HEAD FOOTBOARD | 4 | \$ 33.00 | \$ 132.00 | |
|  | BS-514 BED SIDE CABINET | 2 | \$ 40.00 | \$ 80.00 | |
|  | BS-524 BEDSIDE CABINET | 2 | \$ 52.00 | \$ 104.00 | |
|  | BS-43-1 CRANK SET FOR BACKREST | 3 | \$ 9.50 | \$ 28.50 | |
|  | BS-43-2 CRANK SET FOR FOOTREST | 3 | \$ 9.50 | \$ 28.50 | |
|  | BS-43-3 CRANK SET FOR HEIGHT ADJUSTMENT | 3 | \$ 9.50 | \$ 28.50 | |



Bossay Medical Appliance Co.,Ltd.

ADD:No.11,3rd East Road, Jiangyi Main Street, Leliu Town, Shunde District, Foshan City, Guangdong Province, China
 TEL:86 757 27839511 Mob:86 15626095286 FAX:86 757 27839512

PROFORMA INVOICE

Customer

Name: Febby
 Company PT CHITOSE INTERNASIONAL TBK
 Address: JL INDUSTRI III NO5 CIMAHI
 Contact: febbyzao@gmail.com overseas@chitose-indonesia.com
 Tel: +6222 6031900

Invoice No.: BS20230530
 Date: May30th,2023
 Terms: EXW
 Payment: T/T

| PICTURE | NAME OF ITEM | QTY | UNIT PRICE | AMOUNT | No. |
|---|--|-----|------------|-----------|-----|
|  | BS-019 SIDE RAIL | 2 | \$ 126.00 | \$ 252.00 | 12 |
|  | BS-006A HEAD FOOTBOARD | 3 | \$ 40.00 | \$ 120.00 | 11 |
|  | BS-G204-2 GAS SPRING OF OVER BED TABLE | 10 | \$ 6.00 | \$ 60.00 | |
|  | BS-028 CASTOR CENTRAL LOCK (5 INCH) | 8 | \$ 12.50 | \$ 100.00 | 13 |
|  | BS-028 CASTOR M16X25MM WITHOUT LOCK (6 INCH) | 4 | \$ 9.00 | \$ 36.00 | |
|  | BS-028 CASTOR M16X25MM LOCK (6 INCH) | 4 | \$ 9.30 | \$ 37.20 | |
|  | BS-028 CASTOR M16X25MM WITHOUT LOCK (5 INCH) | 4 | \$ 6.30 | \$ 25.20 | 13 |



Bossay Medical Appliance Co.,Ltd.

ADD:No.11,3rd East Road, Jiangyi Main Street, Leliu Town, Shunde District, Foshan City, Guangdong Province, China

TEL:86 757 27839511

Mob:86 15626095286




FAX:86 757 27839512

PROFORMA INVOICE

Customer

Name: Febby
Company PT CHITOSE INTERNASIONAL TBK
Address: JL INDUSTRI III NO5 CIMAHI
Contact: febbyzao@gmail.com overseas@chitose-indonesia.com
Tel: +6222 6031900

Invoice No.: BS20230530
Date: May30th,2023
Terms: EXW
Payment: T/T

| PICTURE | NAME OF ITEM | QTY | UNIT PRICE | AMOUNT | No. |
|---|---|-----|------------|--------------------|-----|
|  | BS-028 CASTOR M16X25MM LOCK (5 INCH) | 4 | \$ 6.50 | \$ 26.00 | 13 |
|  | BS-028 CASTOR M16X25MM WITHOUT LOCK (4 INCH) | 4 | \$ 4.90 | \$ 19.60 | |
|  | BS-028 CASTOR M16X25MM LOCK (4 INCH) | 4 | \$ 5.00 | \$ 20.00 | |
| DELIVERY COST TO CONTAINER PLACE | | | | \$ 30.00 | |
| BANK COST | | | | \$ 40.00 | |
| TOTAL | | | | \$ 1,978.00 | |

PAYMENT TERMS : 100% T/T before shipment

Delivery Time: 20DAYS after order confirmed

Bank Details

Beneficiary account number:1037 0109 2406 7
Swift code:CITISGSGXXX or CITISGSG
Beneficiary country/region:Singapore
Beneficiary name:Guangdong Bossay Medical Appliance Co., Ltd.
Beneficiary address:8 Shenton Way, #45-01, AXA Tower, Singapore 068811
Beneficiary bank:Citibank N.A Singapore Branch
Beneficiary bank address:08 Marina View #16-01 Asia Square Tower 1 Singapore 018960
Bank code:7214
Branch code:001



Formulir Rekapitulasi : Nilai TDKN ALAT KESEHATAN DAN ALAT KESEHATAN DIAGNOSTIK IN VITRO

| | | |
|----------------------|---|--|
| Penyedia Barang/Jasa | : | PT. Chitose Internasional Tbk |
| Alamat | : | Jl. Industri III no.5 RT.001 RW.009 Kel. Utama , kec. Cimahi selatan, Cimahi, Ja-Bar |
| Hasil Produksi | : | Furniture logam, kayu, Plastik & perawatan Kedokteran |
| Jenis Produk | : | Nursing Bed |
| Spesifikasi | : | CB 3300 PLUS |
| Standar | : | SNI 16-2625-1992 (Tempat Tidur Baja Beroda untuk RS dengan Pengatur Posisi Tidur) |
| No HS Code | : | 0 |

| NO | Uraian | Bobot Penghitungan | KDN | TKDN |
|--|--------------------|--------------------|-------|-------|
| | | | (%) | (%) |
| I | Aspek Manufaktur | 80% | 43,70 | 34,96 |
| II | Aspek Pengembangan | 20% | 72,50 | 14,50 |
| TDKN ALAT KESEHATAN DAN ALAT KESEHATAN DIAGNOSTIK IN VITRO | | | | 49,46 |

Capaian Nilai TKDN diatas dinyatakan sendiri (self assessment) oleh PT. Chitose Internasional Tbk

Formulasi Perhitungan :

% TKDN Alat kesehatan dan Alat Kesehatan Diagnostik In Vitro = % TKDN Aspek Manufaktur + % TKDN Aspek Pengembangan

Cimahi 25 Oktober 2023

Dinyatakan Oleh,
PT. Chitose Internasional Tbk



Susanto ST
Direktur

Formulir 1.9 : Rekapitulasi Penilaian TKDN Aspek Manufaktur

| | |
|----------------------|--|
| Penyedia Barang/Jasa | : PT. Chitose Internasional Tbk |
| Alamat | : Jl. Industri III no.5 RT.001 RW.009 Kel. Utama , kec. Cimahi selatan, Cimahi, Ja-Bar |
| Hasil Produksi | : Furniture logam, kayu, Plastik & perawatan Kedokteran |
| Jenis Produk | : Nursing Bed |
| Spesifikasi | : CB 3300 PLUS |
| Standar | : SNI 16-2625-1992 (Tempat Tidur Baja Beroda untuk RS dengan Pengatur Posisi Tidur) |
| No HS Code | : |

| Uraian | PENILAIAN OLEH PRODUSEN | | | | |
|---|----------------------------------|---------------------|---------------------|--------------|---------------|
| | Biaya per 1 (satu) satuan produk | | | | |
| | Biaya KDN | Biaya KLN | Biaya Total | Persen TKDN | |
| I Bahan (material) Langsung | 80% | | | | |
| 1. Bahan Baku untuk Material Langsung | 2.259.828,49 | 5.367.739,27 | 7.627.567,75 | 29,63 | 96,00% |
| 2. Bahan Baku untuk Biaya Terkait Lainnya | - | - | - | 0,00 | 0,00% |
| Sub Biaya Bahan (Material) Langsung | 2.259.828,49 | 5.367.739,27 | 7.627.567,75 | 23,70 | 96,00% |
| II Tenaga kerja Langsung | 10% | | | | |
| 1. Tenaga Kerja Langsung | 89.219,64 | - | 89.219,64 | 90,18 | 1,12% |
| 2. Tenaga Kerja Langsung untuk Biaya Terkait Lainnya | 9.716,02 | - | 9.716,02 | 9,82 | 0,12% |
| Sub Biaya Tenaga Kerja Langsung | 98.935,66 | - | 98.935,66 | 10,00 | 1,25% |
| III Biaya Tidak Langsung Pabrik (Factory Overhead) | 10% | | | | |
| 1. Tenaga Kerja Tidak Langsung | 8.917,30 | - | 8.917,30 | 4,08 | 0,11% |
| 2. Mesin yang dimiliki | - | - | - | 0,00 | 0,00% |
| 3. Mesin yang Sewa | - | - | - | 0,00 | 0,00% |
| 4. Biaya Tidak LangsungTerkait Lainnya | 209.865,43 | - | 209.865,43 | 95,92 | 2,64% |
| Sub Biaya Biaya Tidak Langsung Pabrik | 218.782,73 | - | 218.782,73 | 10,00 | |
| Biaya Produksi | 2.577.546,87 | 5.367.739,27 | 7.945.286,14 | 43,70 | |

Capaian Nilai TKDN diatas dinyatakan sendiri (self assessment) oleh PT. Chitose Internasional Tbk

Formulasi Perhitungan :

$$\% \text{TKDN Bahan (material) Langsung} = \frac{\text{Biaya Bahan (material) Langsung} - \text{Biaya Komponen Luar Negeri Bahan (material) Langsung}}{\text{Biaya Bahan (material) Langsung}} \times 80\%$$

$$\% \text{TKDN Tenaga Kerja Langsung} = \frac{\text{Biaya Tenaga Kerja Langsung} - \text{Biaya Komponen Luar Negeri Tenaga Kerja Langsung}}{\text{Biaya Tenaga Kerja Langsung}} \times 10\%$$

$$\% \text{TKDN Biaya Tidak Langsung Pabrik} = \frac{\text{Biaya Tidak Langsung Pabrik} - \text{Biaya Komponen Luar Negeri Tidak langsung Pabrik}}{\text{Biaya Tidak Langsung Pabrik}} \times 10\%$$

$$\% \text{TKDN Aspek Manufaktur} = \% \text{TKDN Bahan (material) Langsung} + \% \text{TKDN Tenaga Kerja Langsung} + \% \text{TKDN Biaya Tidak Langsung Pabrik}$$

Cimahi 25 Oktober 2023

Dinyatakan Oleh,
PT. Chitose Internasional Tbk



Susanto ST
Direktur